

H4SD


Honda CBR1000RR 2006-2007

Left side kit:

ID.	Description	Cat.N	Qt
1	SLD adapter	537	1
2	Bolt M12x80x1,25mm	891	1
3	Alu. spacer - 21,5mm	85	1
4	Dural. cylinder - 40mm	12	1
5	Bolt M8x25mm	831	1
6	Poly. cylinder M8 - 20mm	X6	1
7	Washer M8	802	1
8	Steel adapter	521	1
9	Alu. spacer - 10mm	120	1
10	Bolt M6x30mm	864	1
11	Tape 3M	-	1
12	Washer M12	803	1
13	Bolt M10x60	850	1
14	Washer M10 (stringed)	801	1
15	Bolt M8x25	815	2

Right side kit:

ID.	Description	Cat.N	Qt
1	SLD adapter	537	1
2	Bolt M12x90x1,25mm	919	1
3	Bolt M12x85x1,25mm	902	1
4	Alu.spacer - 19mm	83	1
5	Alu. spacer - 17mm	84	1
6	Dural. cylinder - 40mm	12	1
7	Washer M8	802	2
8	Steel adapter	522	1
9	Alu. spacer - 10mm	120	1
10	Bolt M6x30mm	864	1
11	Tape 3M	-	1
12	Washer M12	803	2
13	Bolt M10x60	850	1
14	Washer M10 (stringed)	801	1
15	Bolt M8x25	815	2

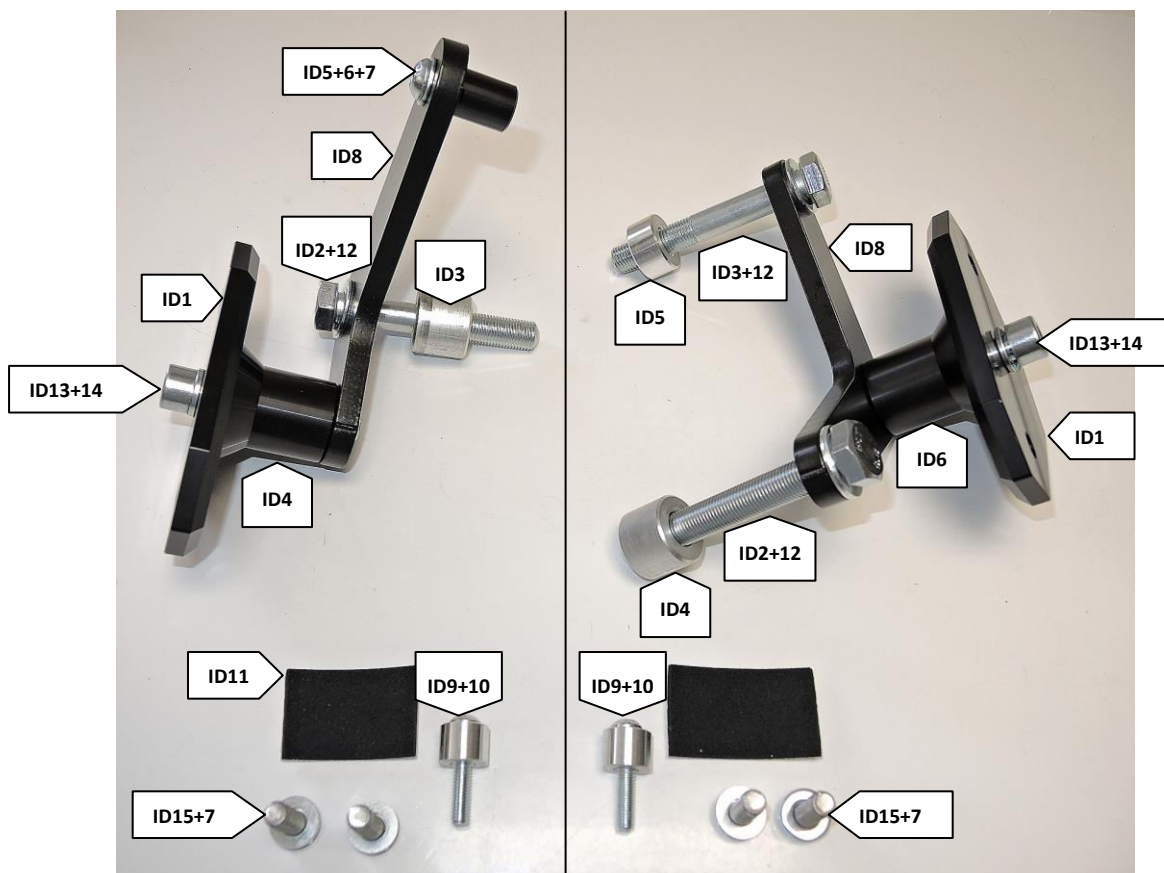

Left side instructions:

1. Remove fairing of motorcycle.
2. Prepare mounting kit for SLD.
 - a. Fit poly cylinder ID6 using bolt ID5 and washer ID7 on steel adapter ID8.
 - b. Fit steel adapter on the motorcycle using bolt ID2+ID12 and cylinder ID3.
 - c. Stick 3M tape ID11 on the alu adapter from back side.
3. Put fairing back on motorcycle and repace original bolt + add alu cylinder according to the picture 3.
4. Fit SLD adapter (ID1) with dural cylinder (ID4) on the steel adapter using bolt (ID13+ID14).
5. Fit protector using two bolts (ID15+ID7).

Right side instructions:

1. Remove fairing of motorcycle.
2. Stick 3M tape ID11 on the alu adapter from back side.
3. Place spacer ID4 – P1 and ID5 – P2 under the adapter and tighten it using bolts ID2-P1 and ID3-P2 according to the picture 2.
4. Put fairing back on motorcycle and repace original bolt using bolt ID10 + add alu cylinder according to the picture 3.
5. Fit SLD adapter (ID1) with dural cylinder (ID6) on the steel adapter using bolt (ID13+ID14).
6. Fit protector using two bolts (ID15+ID7).

Note: Use medium strong glue on all threads.



